Ionizing Radiation Division	44060C	IRD-P-14	
NEUTR	ON PERSONNEL DOSIMET	ΓRY	

Neutron Personnel Dosimetry (44060C)

Purpose

This document describes the setup, measurement, and reporting procedures for calibrations of neutron personnel protection devices, both active (*e.g.* REM balls) and passive (*e.g.* albedo dosimeters).

Scope

This procedure covers calibration of instruments in neutron fields having intensities and character similar to that found in nominally habitable areas. The fields available are those produced by californium-252 sources, either lightly encapsulated and free in air, or in the center of a 15 cm radius heavy water sphere covered with cadmium. Results are reported in either dose equivalent (*i.e.* REM or sievert) for passive instruments, or dose equivalent rate (REM/hour or sievert/hour) for active instruments.

Definitions

This document does not define any new terms.

Equipment

The equipment used for these calibrations has three broad categorizations: positioning equipment, neutron field moderating equipment, and data acquisition equipment.

Positioning Equipment

A *rolling cart* on fixed tracks, driven by a stepping motor, is used to modify the distance between the source and the detector. This cart is constructed of small quantities of materials having relatively low neutron scattering cross sections (*i.e.* aluminum and steel) and is a height such that various types of neutron instruments can be positioned above it without mechanical modification of the cart itself.

Changes in the position of the rolling cart are measured using a *tape measure* attached to the floor of the calibration room. A steel indicator connected to the bottom of the rolling cart indicates the position of the cart to approximately 1 mm (the indicator can be read out using a video camera attached to the cart and aimed at the indicator). This information, in combination with the procedure for positioning of the instrument on the cart as described in "Positioning of Detector/Phantom", allows the absolute distance between the detector and the mechanical location of the source to be set to approximately 1 mm resolution.

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		1 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14	
NEUTR	ON PERSONNEL DOSIMET	ΓRY	

The sources are raised and lowered using a *fishing reel and kevlar thread*. This allows the person raising and lowering the sources to minimize exposure to radiation.

Mechanical positioning of bare sources is achieved using an aluminum *source holder* pictured below in Figure 1. A source attached to the kevlar thread mentioned above will snugly seat at the bottom of the central aluminum cylinder. The source holder is attached (indirectly) to the steel I-beams holding up the aluminum floor above the calibration range.

Figure 1: Source positioning apparatus



The height of the most standard size REM ball above the rolling cart platform is set using a "*ring stand*" specifically designed and constructed for this purpose. A grooved circular ring (pictured below as both a photograph (Figure 2) and a mechanical drawing (Figure 3)) holds three 19.05 mm (0.75") diameter ball bearings. The center of a so-called "9-inch" REM ball above the bottom of the grooved ring with the ball bearings in position is calculated to be 11.41 cm. Aluminum legs are attached to the ring to position the REM ball above the rolling table platform. The heights of the bare and D₂O-moderated sources above the rolling table platform have been measured in the past and are 31.9 cm and 30.3 cm, respectively.


Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		2 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14	
	ON PERSONNEL DOSIME	ΓRΥ	

Figure 2: Ring stand used to hold "9-inch" REM ball



Figure 3: Mechanical design of the REM ball ring stand.

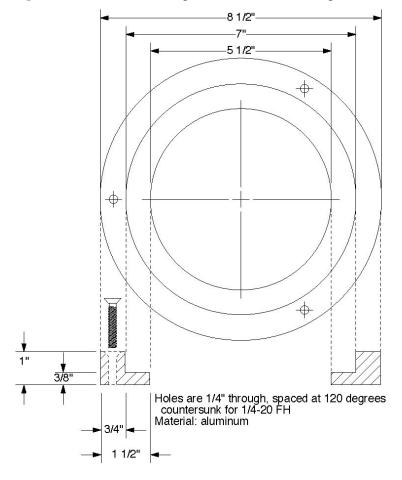

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		3 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14	
NEUTR	ON PERSONNEL DOSIMET	ΓRY	

Environmental effects on positioning equipment

Positioning equipment is in principle subject to change of size as a function of temperature. Since we measure using a steel measuring tape and an aluminum meter stick, changes in their size could cause us to position the instruments incorrectly. Steel has a thermal expansion coefficient of approximately 15×10^{-6} C⁻¹, while aluminum alloys have a coefficient of 23×10^{-6} C⁻¹. The longest distances used in these calibrations are around 2.5 m, which would require a temperature change of 18 C to equal our current positioning uncertainty for aluminum (a larger temperature change would be required to degrade our measurement for steel). The temperature of the calibration range is controlled to ± 5 C, so this is not a significant source of error.

Neutron Field Moderating Equipment

The D_2O Sphere is described in Reference 2.

The *PMMA phantom* is specified in ANSI N13.11.

The ISO water slab phantom is specified in ISO 8529-3:1998, section 6.2.2.

Data Acquisition Equipment

Because of the wide variety of instruments we receive, and the need to use their associated electronics as part of the testing procedure, our data acquisition system is heavily dependent on reading out the instruments using *video cameras*. These video cameras point to the steel indicator showing the location of the rolling cart and to the readout of the instrument. Additional cameras show when the source is in position, and when it has been safely put back into storage.

A *USB Video Frame Grabber* is used to save the video images to the hard disk of a *Macintosh data acquisition computer*. Software on the computer saves the video image at specified time intervals for later readout and analysis. The time at which the image was taken is encoded in the image file name. The accuracy of the hardware/software combination has been tested by recording a digital watch using the software and verifying that the reported delays from the file name and the time from the watch image were the same within the accuracy of both (1 second over a 20 minute measurement).

Software

Although these calibrations could in principle be performed with a stop watch, video camera, and lab notebook, in fact the data is acquired, time stamped, stored, and analyzed using custom software. This software is stored in a CVS (Concurrent Versioning System) repository on irdilbert.ncnr.nist.gov. Use of the software, including selections from the source code, is described in "Appendix A: Source Flux Calculation & Data Analysis Software", "Appendix B: Dosimetry Video Data Acquisition Software", and "Appendix C: Video Analysis Software".

Comments in the CVS repository will indicate validation of new versions of the

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		4 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14
NEUTR	ON PERSONNEL DOSIMET	ΓRY

software. While the binary parts of the experiments are constantly changing as calculations are made and data entered, all of the source code should be stable and validation of new versions will be indicated in the CVS repository comments. Only validated versions of the code will be used for actual calibrations.

Safety

ALARA procedures are observed with guidance from the NIST Health Physics group. "Distance" and "shielding" (being out of the room when the source is raised) are vastly preferred to "Time" (staying in the vicinity of the source for as little time as possible).

Standard laboratory safety procedures for lifting detectors, minimizing contact with cadmium, etc., are carefully observed.

Procedures

Device Acceptance Criteria

Upon receipt of customer artifacts (active or passive detectors) shipping containers are inspected for damage. If there is significant damage of the shipping container, the client is contacted immediately and guidance requested. Otherwise, the shipping container is opened and the devices are inspected. For dosimeters, which are designed to withstand large amounts of physical abuse, the only requirement is that the active elements have not become detached from the protective cover, and that the protective cover has not come apart in any way.

For active instruments, all cable connections are tested for mechanical stability, and displays are checked for cracks, bent dials, etc. Then the instrument is turned on, in "battery/ display check" mode if available. If the instrument passes this test, it is turned on in the most sensitive setting available. Since the neutron background is very low, a reading above 0.1 mREM/hr is a cause for worry, and is discussed with the client.

Determination of Room Return

Room return is determined and applied as described in *ISO* 8529-2:2000, section 6.3.3, with the addition of a "quartic" term for some source-detector combination, *i.e.* equation (19) now reads:

$$\frac{M_T(l)}{\Phi F_1(l)(1+Al)} = RF(1+Sl^2+Ql^4)$$

The values of S, Q and A currently in use are shown below in Table 1.

Changes in the arrangement of materials, especially hydrogenous materials, in the calibration range can change the room return corrections. The person performing the

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		5 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14
NEUTR	ΓRY	

calibration ensures and documents that no sizeable shift of material has occurred in the room before starting a calibration. Moving any large pieces of material to the edge of the room away from the detector should eliminate any effects on room return since scattering from the wall of the room dwarfs any scattering from a movable piece of material. After significant changes to the arrangement of material in the calibration range room calibrations shall cease until room return corrections can be verified.

Table 1: Room Return and Air Scatter Corrections

Device	S (Bare) Quadratic (m ⁻²)	A (Bare) Air Scatter (m ⁻¹)	S (Moderated) Quadratic (m ⁻²)	Q (Moderated) Quartic (m ⁻⁴)	A (Moderated) Air Scatter (m ⁻¹)
3" sphere	33%	1.2%	13.%		4.5%
Albedo Dosimeter	20%	1.2%	5.4%		3.7%
9" Spherical Remmeter	5.3%	1.2%	7.35%	- 0.28%	2.6%
Andersson-Braun Remmeter		1.2%	9.53%	- 0.51%	2.6%
REM500	4%	1.2%	4.5%		1.4%

Fluence Rate Calculation

The source emission rate is calculated with the algorithms used in Reference 3. Parameters for sources currently in use are shown in Table 2. Source calibrations were done by NIST and are traceable to the NIST reference RaBe neutron source, NBS-1. Sources are periodically recalibrated as resources allow.

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		6 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14			
NEUTRON PERSONNEL DOSIMETRY					

Table 2: Parameters Used for Source Fluence Calculation Table 2: Parameters Used for Source Fluence Calculation

Source Name	Source Calibration Date	Calibrated Fluence Rate (s ⁻¹)	Isotopic Calibration Date	Isotopic Percent ²⁵⁰ Cf	Isotopic Percent 252Cf	Isotopic Percent ²⁵⁴ Cf
NS-118	2/1/94	4.79×10 ⁸	2/14/85	8.16	86.26	0.021
NS-100	10/18/94	1.03×10 ⁸	7/2/75	8.05	87.7	0.028
NS-39	8/17/94	6.08×10 ⁶	12/20/70	10.83	84.82	0.028
Cf-144	2/20/83	1.27×10 ⁷	7/27/70	9.76	84.34	0.017
NS-130	1/10/90	4.42×10 ⁹	2/23/87	8.33	85.08	0.014
NS-108	10/30/86	1.123×10 ⁹	9/26/77	7.736	87.726	0.039
NBS-131	1/10/94	6.87×10 ⁹	9/2/92	9.22	81.99	0.018

Source fluence rate in cm s⁻² is converted to dose equivalent rate using the conversion factors in section 4.a of reference 4. These differ from the conversion factors in reference 1 to be consistent with Nuclear Regulatory Commission regulations (and thus relevant to the needs of our clients).

Positioning of Detector/Phantom

The vertical distance from the rolling cart platform to the center of the source has been previously measured as discussed in the paragraph discussing the "ring stand". The PMMA phantom has a specific platform on which it rests to make its center be at the same height as the source. "9-inch" REM balls have the "ring stand" to set their position. Any other detectors or phantoms are vertically positioned using a lab jack and ruler.

The horizontal position of the detector or phantom *in the direction radially away* from the source is set by moving the rolling cart to approximately the correct position (e.g. such that the scale reads 15.0 cm) and then measuring the distance between the source position and the surface of the detector. For the bare sources, the distance measured is from the bottom center of the central vertical aluminum tube to the detector. For moderated sources, the instrument is moved to be almost in contact with the moderating sphere (a piece of paper can be moved with a small amount of resistance between the detector and sphere, but will not support its own weight). For calculating the source center – detector center distance the moderating sphere is assumed to have a radius of 15.26 cm (e.g. a detector with radius 10 cm in near contact with the moderating sphere would have a source center – detector center distance of 25.26 cm) as described in reference 2.

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		7 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14		
NEUTRON PERSONNEL DOSIMETRY				

The horizontal position of phantoms and detectors in the direction perpendicular to the axis connecting the center of the source and the center of the detector is set by aligning the detector/phantom to a mark on the platform of the rolling cart.

Experimental Procedure - Dosimeters and Other Passive Devices

For dosimeters, the phantom is positioned as described above in "Positioning of Detector/ Phantom". Strips of weather stripping (~2 mm thick foam, sticky on both sides) are attached to the phantom, and the dosimeters are pressed against the weather stripping so they will stay in position (being careful to not move the cart or phantom in the process). On occasion the dosimeters have to be taped from the front as well using thin packing tape.

If more than one dosimeter is to be irradiated, the dosimeters are arranged in a circle centered on the phantom's face, with all dosimeters oriented the same with respect to the center of the circle (*i.e.* the "top" of the dosimeter is further from the center than the "bottom"). SP 250–12 (reference 4, page 8) states that the source detector distance is calculated from the source to the circle radius; this is no longer done because the position of the active elements within the dosimeter is difficult to determine, and the change to the distance is of the same order as the uncertainty in the position of the source/position of the dosimeter.

As soon as the source clears the top of the storage the stopwatch (Cole-Parmer Model 94410-10 or equivalent) is started. The time that the source reaches the irradiation position is recorded. The source is left in position until the stopwatch reads the required time for the requested dose. At that point, the source is lowered. The time at which the source reaches the top of the storage system is also recorded. Assuming the same time to raise and lower, and that the dose delivered to the dosimeters during raising and lowering is roughly 50% of the source-in-position dose, this should yield dosimeters that have the correct dose. Both of these assumptions have associated uncertainties, so the dose reported to the customer is the dose delivered in position plus 50% of the dose that would have been delivered had the dosimeters been in position during raising and lowering, with uncertainty in the time the source was up being the total time the source was being raised and lowered. Typically this is a small contribution to the total uncertainty.

Any dosimeter which falls off of the phantom during irradiation is reported as spoiled to the customer. All dosimeters (including unirradiated, irradiated, and control dosimeters) are stored in the same location, which is typically in the office area outside of the low scatter room itself (this is partly to mitigate any effect of heat on dosimeters; the office areas temperature is regulated better than the calibration range). Because dosimeters can be sensitive to heat, and are sensitive to radiation, they are shipped to the customer overnight with care taken that they will not be in storage at a shipping company's facility over a weekend.

Experimental Procedure - Active Devices

There are two sets of procedures for active devices, depending on whether the device supports "integration" mode or just "ratemeter" mode. If the device will

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		8 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14		
NEUTRON PERSONNEL DOSIMETRY				

integrate the dose received over a long time period (minutes to hours) higher accuracy can be achieved. Most digital meters can do this; no recently calibrated analog meters have had this feature.

All devices are set up such that the readout fills as much of the video screen as is practical. Analog meters are set up such that shadows from the indicator can be readily distinguished from the indicator itself on saved video images. Only images from which a clean and unambiguous reading of the meter are accepted for analysis; other images are marked in the analysis software as missing data.

Ratemeter mode devices

Ratemeter mode devices are positioned as described in "Positioning of Detector/Phantom". A source is raised (or the readout unit is attached to an electronic simulator of detector signals) and the refresh rate of the instrument is observed. Readouts of the video camera are taken, if at all possible, at a rate at least three times smaller than the refresh rate of the meter to avoid any correlations between readings. Typically the meter is read out at a rate more than ten times smaller than the refresh rate.

At least ten readings are taken at each dose-equivalent rate so a good estimate of uncertainty can be extracted from the data, even if a few of the images are unreadable due to changes in the readout during the video frame grab.

Integrating Devices

These devices are also positioned as described in "Positioning of Detector/Phantom". The meter is reset and the source raised into position as soon as possible afterwards (a small amount of time is needed to allow the scientific staff to evacuate the calibration range). The integrated dose is read out through the video camera at a rate such that as many digits change on the display as possible. The integrated dose *vs.* time is fit to a line, with uncertainty in the dose rate set to the 95% confidence interval around the fit value of the slope. (The confidence interval is calculated from the fit uncertainty and the Student's T distribution; the fit uncertainty is output by the Singular Value Decomposition and/or Levenberg-Marquardt software used to fit the data. See reference 5 for details.).

Stability Checks

Although these checks are only performed at the request of the customer, the stability of the instrument can be checked by making repeated measurements (either in ratemeter mode or in integration mode) in a fixed neutron field. In ratemeter mode, deviation from a flat line indicate stability issues; in integration mode, curvature to the line can be observed. Stability issues at the level of 10% are common. If there is any instability, the sensitivity of the instrument essentially always increases with received dose equivalent, and appears to follow an exponentially asymptotic functional form with either time or dose equivalent.

A less informative stability check is to move the meter back to a previously measured point and re-measure the calibration factor at that point. This will often reveal the same level of instabilities as the above check

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		9 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14		
NEUTRON PERSONNEL DOSIMETRY				

Uncertainty Analysis

The basis for the determination of uncertainties associated with the calibration of neutron personnel dosimetry devices is reference 6. Uncertainties specific to the type of device (active or passive) are discussed above (see "Experimental Procedure - Dosimeters And Other Passive Devices" and "Experimental Procedure - Active Devices"). Our uncertainties (and central values) are periodically verified in comparisons with other National Measurement Institutes, as specified in IRD-QM-II, section 4.2.2.2.

Source strength uncertainties are derived from source strength calibrations. These uncertainties are Type B, and are consistent for all measurements using a given source.

Room return correction uncertainties are 40% (k=2) of the room return correction and are Type B. See reference 4 for a discussion of the derivation of this uncertainty.

Source-detector distance uncertainties are dominated by the uncertainty in the position of the effective center of the instrument (5mm, see reference 4 for details), but includes a small contribution (1 mm) from uncertainty in the readout of distance and the measurement of source-detector distance during initial positioning. Because the relationship of dose-equivalent rate to source-detector distance goes as the inverse square, this error must be carefully propagated. This uncertainty is Type B.

Uncertainty in the conversion from neutron fluence rate to dose equivalent rate is described in reference 4. It is 2% for bare sources and 8% (both k=2) for moderated sources, and is Type B.

Instrument stability, as described at the end of section "Experimental Procedure - Active Devices", is measured and reported to the client, but not added to the total uncertainty. This is because the way in which the calibrated instrument is used by the client may eliminate this uncertainty (*i.e.* if it is used as a "field instrument" this uncertainty will not manifest itself).

The full uncertainty analysis can be gleaned from the source code selections in "Appendix A: Source Flux Calculation & Data Analysis Software".

Records

Procedures Specific to Dosimeters and Other Passive Devices

For passive instruments, raw data is recorded by hand in a laboratory notebook. Data is recorded and maintained as specified in IRD-G-06 and section 4.3.4.2 of IRD-QM-II.

Procedures Specific to Active Devices

Raw data files (screen dumps) are copied from the data acquisition machine to h122.113.ncnr.nist.gov as quickly as possible after acquisition. These files may be moderately processed before copying (e.g. cropping the images to remove unneeded backgrounds, file format conversion) but not in a way that will visibly degrade the image.

A file containing the transcribed video data and derived averages and uncertainties in those averages is generated as part of the analysis. This file is stored in the appropriate

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		10 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14		
NEUTRON PERSONNEL DOSIMETRY				

folder on h122.113.ncnr.nist.gov. See "Appendix C: Video Analysis Software" for more information about this intermediate file.

References

- 1. ISO 8529 Series: Reference Neutron Radiations.
- 2. R.B. Schwartz and C.M. Eisenhauer, *The Design and Construction of a D₂O-Moderated* ²⁵²Cf Source for Calibrating Neutron Personnel Dosimeters Used at Nuclear Power Reactors, NUREG/CR-1204, January, 1980.
- 3. NBS Measurement Services: Neutron Source Strength Calibrations at NBS by the Manganese Sulfate Bath Method, E. D. McGarry and E. W. Boswell, Natl. Bur. Stand. (U.S.), Spec. Publ. 250–18 (Mar. 1988), Appendix C.
- 4. NBS Measurement Services: Neutron Personnel Dosimetry, R. B. Schwartz, Natl. Bur. Stand. (U.S.), Spec. Publ. 250–12 (July 1987).
- 5. Igor Pro Manual, available from www.wavemetrics.com with purchase of software.
- 6. NIST Technical Note 1297, Guidelines for evaluating and Expressing the Uncertainty of NIST Measurement Results.

Filing and Retention

Calculations associated with a calibration, as well as electronic copies of reports and any pertinent data, are kept in folders on dilbert.nist.gov in a folder titled "Instrument Calibration Reports." These folders are identified with the year and month of the calibration (starting date), the name of the institution submitting the detectors, and the NIST folder number (after it has been received). These calculations are stored in Igor Text Format (.itf), which can be easily reloaded into Igor for later checks, but are also human readable. As with all data on h122.113.ncnr.nist.gov, these files are backed up approximately weekly to optical media, and are maintained for at least as long as the valid time of the report as specified on the calibration folder (usually three years).

After all required signatures have been obtained, the original of the report is sent to the customer and copies are placed into the calibration folder to be returned to the calibration office, and to a file folder containing other relevant information to be stored locally. These file folders are labeled with the same information as the computer file folders on dilbert.nist.gov.

The IRD Quality Manager shall maintain the original and all past versions of this IRD Procedure. Copies of the current revision of this Procedure shall be placed in controlled Quality Manuals. Electronic copies of this Procedure are uncontrolled versions.

All deleted Procedures (including old revisions) shall be maintained by the IRD Quality Manager. All old revisions shall be maintained until such time as it is decided to delete the Procedure. Once the decision has been made to delete the Procedure, only the last revision shall be maintained by the IRD Quality Manager.

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		11 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14			
NEUTRON PERSONNEL DOSIMETRY					

Appendix A: Source Flux Calculation & Data Analysis Software

Overview

An Igor experiment file is used to calculate fluence rates, plan experiments, and analyze data (after basic averaging has already been done by the Video Analysis experiment described in "Appendix C: Video Analysis Software"). The experiment and associated code is stored in a CVS server on irdilbert.ncnr.nist.gov at /cvs/SourceFluxCalc, and is backed up onto optical media as necessary.

Usage

Planning

Planning an experiment is done by bringing to the front either the "PlanTable" table or the "PlanTableDosimeter" table (depending on whether the calibration is for an active or passive instrument). Conversion and correction factors are set by entering "convAndCorr = convAndCorr9inMod" (or another appropriate conversion and correction wave, depending on the source and detector) on the command line. The values desired for dose equivalent rate or dose are entered into the appropriate columns (note: all columns requiring user input appear in bold) and "DoPlanCalib" or "DoPlanCalibDosimeter" are selected from the Macros menu, as appropriate.

Planning for Active Instruments

The source chosen for a given rate can be modified to keep the source surface-detector surface distance (D_SS) and background correction (CorrPCT) in reasonable ranges. Ideally, D_SS should be more than 5 cm (10 cm for bare sources), but the only requirement is that D_SS be greater than or equal to zero. Corrections, ideally, should be less than 10%; they must be less than 40%.

D_SS, coupled with the knowledge of the relationship between the position of the instrument and the scale reading, allows the user to determine scale positions for each requested dose equivalent rate.

Planning for Dosimeters

Because the distance between the source center and phantom surface is set to be 50 cm, only the irradiation time and source can be adjusted. A source is chosen such that the irradiation time is significantly longer than the raising and lowering time of the source, ideally by a factor of 100 or more.

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		12 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14		
NEUTRON PERSONNEL DOSIMETRY				

Analysis

For both types of instruments, the tables "AnalysisTable" and "AnalysisTableUncert" are brought to the front of the screen.

Active Instruments

The actual scale distances and instrument reading are entered into the appropriate (boldface) columns. D_SS is calculated on the command line from the positioning measurements. For data taken using the method specified in "Integrating Devices" the number of measurements taken during each integration is also entered.

Raw uncertainties are entered into the (boldface) "dReadingAbs" column in the "AnalysisTableUncert" table. "dReading" (in percent) is calculated on the command line from dReadingAbs and Reading.

The macro "CrunchCalibNew" is used to analyze the data, and produces a summary of results in the history area. This macro takes one argument, which is one for data taken with integrating active devices, and zero for ratemeter devices.

Dosimeters

For dosimeters, the time *during which the source is in position* (*i.e.* subtracting the raising and lowering time) is entered into "TimeUp", and the sum of the raising and lowering time should be entered into "dTimeUp". After running the "CrunchCalibDosimiter" macro, the user should verify that D_CC is 50 cm, and D_SS is appropriate for the source (bare or moderated) in use. The wave "RealDose" will contain the total dose received by the dosimeter corrected for room-return and air scatter backgrounds.

Source Code

Selections from the source code are presented below for information.

Function/D NActivity(Name, month, day, year) String Name; variable/d month,day,year variable index;

 $NVAR\ cfSourceCalibDate = root:cfCalibFolder:cfSourceCalibDate$

 $NVAR\ cfSourceCalibVal = root:cfCalibFolder:cfSourceCalibVal$

 $NVAR\ CfAtomCompCalibDate = root:cfCalibFolder:CfAtomCompCalibDate$

CfAtomCompCalib, sourceAtomComps, sourceCalibDates, sourceCalibFluence, atomCompDates, CfNus, CfActivityACC

WAVE CfActivityACC = root:cfCalibFolder:CfActivityACC WAVE CfAtomCompCalib = root:cfCalibFolder:CfAtomCompCalib WAVE sourceAtomComps = root:cfCalibFolder:sourceAtomComps WAVE sourceCalibDates = root:cfCalibFolder:sourceCalibDates WAVE sourceCalibFluence = root:cfCalibFolder:sourceCalibFluence WAVE atomCompDates = root:cfCalibFolder:atomCompDates WAVE CfNus = root:cfCalibFolder:CfNus WAVE CfHalfLives = root:cfCalibFolder:CfHalfLives WAVE CfAlphaSFRatios = root:cfCalibFolder:CfAlphaSFRatios WAVE CfActivitySC = root:cfCalibFolder:CfActivitySC WAVE/T sourcenames = root:cfCalibFolder:sourcenames

// find which source this is in the list -- index then will find all other information

about the source index =

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		13 of 28	Procedure14v110

NEUTRON PERSONNEL DOSIMETRY FindStringInWave(sourcenames,Name) if(index < return(NaN) endif CfAtomCompCalib[] = sourceAtomComps[index][p]; Renorm(CfAtomCompCalib); // make the isotopic composition add up to 100% cfSourceCalibDate = sourceCalibDates[index]; cfSourceCalibVal = sourceCalibFluence[index]; CfAtomCompCalibDate = atomCompDates[index]; // this is on atomic calibration date CfActivityACC = (ln(2)*CfNus*CfAtomCompCalib/(CfHalfLives*(CfAlphaSFRatios+1)))// this is on source strength calibration date $CfActivitySC = CfActivityACC*exp(-ln(2)*(CfSourceCalibDate-CfAtomCompCalibDate)/\ CfHalfLives)$ return(Activity(month,day,year)) End Function/D Activity(month, day, year) variable/d day,month,year make/n=3/o/d cfAct NVAR CfSourceCalibDate = root:cfCalibFolder:CfSourceCalibDate $NVAR\ cfSourceCalibVal = root:cfCalibFolder:cfSourceCalibVal$ WAVE CfActivitySC = root:cfCalibFolder:CfActivitySC WAVE CfHalfLives = root:cfCalibFolder:CfHalfLives WAVE cfActivitySC = root:cfCalibFolder:cfActivitySC CfAct[] = CfActivitySC[p]*exp(-ln(2)*(date2secs(year,month,day)-CfSourceCalibDate)/ CfHalfLives[p]); // print day, "/",month,"/",year // cfAct = CfActivitySC*exp(-ln(2)*(date2secs(1994,10,18)-CfSourceCalibDate)/CfHalfLives) cfAct = CfActivitySC*exp(-ln(2)*(date2secs(year,month,day)-CfSourceCalibDate)/ CfHalfLives) // print sumwave(cfAct), sumwave(cfactivitySC), cfSourceCalibVal return(cfSourceCalibVal*SumWave(cfAct)/SumWave(cfActivitySC)); End Macro CrunchCalib() variable whichSource=-1; String fldrSav= GetDataFolder(1) SetDataFolder root:InstrCalibAnalysis: SourceFluence = NActivity(sourceName, mmonth, mday, myear) $D_CC = D_SS - convAndCorr[1]$ FFDE = SourceFluence*convAndCorr[0]/(D_CC)^2 $CorrPct = convAndCorr[2]*D_SS/100 + convAndCorr[3]*(D_CC/100)^2 + convAndCorr[4]*((D_CC/100)^4) + convAndCorr[4]*((D_CC/100)^4) + (D_CC/100)^4) + (D_CC/100)^4 + (D_CC/100)^4) + (D_CC/100)^4 + (D_CC/100)^4 + (D_CC/100)^4 + (D_CC/100)^4 + (D_CC/100)^4 + (D_CC/1$ // non-point correction, added 8/13/98 $CorrPct += 100*convAndCorr[5]/(4*D_CC^2);$ RealDose = FFDE*(1 + CorrPct/100)

CalFac = RealDose/Reading // multiply everything by two here to adhere to new NIST policy -- AKT 8/20/97 $// \bullet dO = 2*1.2$ // look up source uncertainties in wave dQ = 2*root:cfCalibFolder:uncert[FindStringInWave(root:cfCalibFolder:tsources, sourceName)] dCorr = 2*CorrPct/5 // change formula for "dDists" to reflect source of uncertainty better; dR/R is 0.5 cm. -- AKT 12/9/98 dDists = 2*(2*0.5/D CC)*100dConv = FindStringInWave(root:cfCalibFolder:sourceNames, sourceName) dConv = 2*(1 + (abs(cmpstr(root:cfCalibFolder:sourcetype[dConv],"bare")))*3) $dTotal = sqrt(dQ^2 + dCorr^2 + dDists^2 + dReading^2 + dConv^2)$ print "Did you remember to multiply dReading by 2?" print "Weighted Average Calibration Factor is ",CalcMeanCalib(CalFac, dTotal, 1)," ± ",CalcMeanCalib(CalFac, dTotal, 0)," %" wavestats/q CalFac

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		14 of 28	Procedure14v110

NEUTRON PERSONNEL DOSIMETRY

```
print "Statistical Average Calibration Factor is ",V_avg, " ± ", 200*V_sdev/ (V_avg*sqrt(V_npnts)),"
        wavestats/q CorrPct
        print "Corrections range from ", V_min, " to ", V_max
        wavestats/q dReading
       print "Type A uncertainties range from ", V_min, " to ", V_max
       wavestats/q dO
       print "Source uncertainties range from ", V_min, " to ", V_max
       wavestats/q dCorr
        print "Correction uncertainties range from ", V_min, " to ", V_max
        wavestats/q dDists
       print "Distance uncertainties range from ", V_min, " to ", V_max
       print ""
       SetDataFolder fldrSav End
Macro CrunchCalibNew(LinAnalysis)
       variable LinAnalysis=0;// was the data taken in integral mode and fit to a line? -- akt 20030709-1515
       variable which Source =- 1:
        variable WeightedUncert;
       String fldrSav= GetDataFolder(1)
       SetDataFolder root:InstrCalibAnalysis:
       SourceFluence = NActivity(sourceName, mmonth, mday, myear)
       D_CC = D_SS - convAndCorr[1]
       FFDE = SourceFluence*convAndCorr[0]/(D CC)^2
       CorrPct = convAndCorr[2]*D\_SS/100 + convAndCorr[3]*(D\_CC/100)^2 + convAndCorr[4]*((D\_CC/100)^2 + convAndCorr[4]*((D\_CC/100
100)^4 ) // non-point correction, added 8/13/98 CorrPct += 100*convAndCorr[5]/(4*D_CC^2); RealDose = FFDE*(1 +
        CorrPct/100) CalFac = RealDose/Reading // multiply everything by two here to adhere to new NIST policy -- AKT
        8/20/97 // \cdot dQ = 2*1.2 // look up source uncertainties in wave dQ =
       2*root:cfCalibFolder:uncert[FindStringInWave(root:cfCalibFolder:tsources,
sourceName)] dCorr = 2*CorrPct/5 dCony = FindStringInWave(root;cfCalibFolder;sourceNames, sourceName) dCony = 2*(1
        + (abs(cmpstr(root:cfCalibFolder:sourcetype[dConv], "bare")))*3) // change formula for "dDists" to reflect source of
       uncertainty better; dR/R is 0.5 cm.
-- AKT 12/9/98 // "2" in there is because it goes as r^2 -- akt 20021001 1317 dDists = (2*0.5/D_CC)*100 dTotalCorrelated =
       sqrt(dQ^2 + dCorr^2 + dConv^2); if( LinAnalysis )
               // if linear analysis, dReading's are k=2 confidence intervals // already, propagate-- akt 20031201-1137
               dTotalUncorrelated = sqrt(dDists^2 + dReading^2); // -- akt 20030709-1515
       else // otherwise, dReading's are standard deviations of data and need to be // turned into confidence intervals -- akt
                20031201-1137 // line below was only choice before; not sure why dReading is // where it is -- akt 20030709-1515
                dTotalUncorrelated = StudentT(erf(2/sqrt(2)),NumMeas)*sqrt(dDists^2 + dReading^2) dTotalUncorrelated /=
                sqrt(NumMeas);
       dTotal = sqrt(dTotalCorrelated^2 + dTotalUncorrelated^2)
       print "SourceFluxCalcProc revision $Revision: 1.13 $";
       print "Did you remember to multiply dReading by ONLY 100?"
       // CalcMeanCalib(dTotalCorrelated, dTotalUncorrelated, 1) calculates the "average"
correlated uncertainty -- akt 20021001 1840
// "4*" removed -- akt 20031201 1123 WeightedUncert = sqrt(4*CalcMeanCalib(CalFac,
dTotalUncorrelated, 0)^2 + CalcMeanCalib(dTotalCorrelated, dTotalUncorrelated, 1)^2);
            WeightedUncert = sqrt(CalcMeanCalib(CalFac, dTotalUncorrelated, 0)^2 +
   CalcMeanCalib(dTotalCorrelated, dTotalUncorrelated, 1)^2); print "Weighted Average Calibration Factor is
    ",CalcMeanCalib(CalFac,
dTotalUncorrelated, 1)," ± ",WeightedUncert," %" wavestats/q CalFac print "Statistical Average Calibration Factor is
        ",V_avg, " ± ", 200*V_sdev/
(V_avg*sqrt(V_npnts))," %" wavestats/q CorrPct print "Corrections range from ", V_min, " to ", V_max wavestats/q
       dReading print "Type A uncertainties range from ", 2*V_min, " to ", 2*V_max wavestats/q dQ print "Source
       uncertainties range from ", V_min, " to ", V_max wavestats/q dCorr print "Correction uncertainties range from ", V_min,
        " to ", V_max wavestats/q dDists print "Distance uncertainties range from ", 2*V_min, " to ", 2*V_max print ""
       SetDataFolder fldrSav
```

End

Function CalcCorrPct(coeffs, eks) wave coeffs; variable eks; // say that eks is D_SS // D_CC = (D_SS - convAndCorr[1]) // =

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		15 of 28	Procedure14v110

NEOTRON LERSONNEL DOSIMETR I

 $(eks - convAndCorr[1]) \ variable \ answer; \ answer = coeffs[2]*eks/100 + coeffs[3]*((eks - coeffs[1])/100)^2 + coeffs[4]*(((eks - coeffs[4])/100)^2 + coeffs[4])$

coeffs[1]/100)⁴) answer += $100*coeffs[5]/(4*(eks - coeffs[1])^2)$; return answer;

Macro CrunchCalibDosimeter() variable whichSource=-1; String fldrSav= GetDataFolder(1) SetDataFolder root:InstrCalibAnalysis:

SourceFluence = NActivity(sourceName, mmonth, mday, myear)

 $//D_CC = D_SS - convAndCorr[1]$

 $D_CC = 50$

D SS = D CC + convAndCorr[1]

FFDE = SourceFluence*convAndCorr[0]/(D_CC)^2

 $CorrPct = convAndCorr[2]*D_SS/100 + convAndCorr[3]*(D_CC/100)^2 + convAndCorr[4]*((D_CC/100)^2 + convAndCorr[4]*((D_CC/100$

100)^4) RealDose = FFDE*(1 + CorrPct/100) Reading = RealDose*(TimeUp + 0.5*dTimeUp)/3600 FFDE *= (TimeUp + 0.5*dTimeUp)/3600 CalFac = RealDose/Reading // multiply everything by two here to adhere to new NIST policy -- AKT 8/20/97 //•dQ = 2*1.2 // look up source uncertainties in wave dQ =

2*root:cfCalibFolder:uncert[FindStringInWave(root:cfCalibFolder:tsources,

sourceName)] dCorr = 2*CorrPct/5 dDists = 2*(1.0/D_CC)*100 dConv =

FindStringInWave(root:cfCalibFolder:sourceNames, sourceName) dConv = 2*(1 +

 $(abs(cmpstr(root:cfCalibFolder:sourcetype[dConv],"bare")))*3) dReading = 2*100*dTimeUp/TimeUp; dTotal = sqrt(dQ^2 + dCorr^2 + dDists^2 + dReading^2 + dConv^2)$

print " \dot{A} Il uncertainties are k=2" wavestats/q CorrPct print "Corrections range from ", V_m in, " to ", V_m in, "

Macro DoPlanCalib() PlanCalib() End

SetDataFolder fldrSav End

Macro DoPlanCalibDosimeter() PlanCalibDosimeter() End

Function PlanCalibDosimeter() WAVE SourceFluence = root:InstrCalibAnalysis:SourceFluence WAVE D_CC = root:InstrCalibAnalysis:D_CC WAVE CorrPct = root:InstrCalibAnalysis:CorrPct WAVE D_SS = root:InstrCalibAnalysis:D_SS WAVE convAndCorr = root:InstrCalibAnalysis:convAndCorr WAVE RealDose = root:InstrCalibAnalysis:RealDose WAVE mmonth = root:InstrCalibAnalysis:mmonth WAVE mday = root:InstrCalibAnalysis:mday WAVE myear = root:InstrCalibAnalysis:myear WAVE FFDE = root:InstrCalibAnalysis:FFDE WAVE TimeUp = root:InstrCalibAnalysis:TimeUp WAVE Reading = root:InstrCalibAnalysis:Reading WAVE/T sourceName = root:InstrCalibAnalysis:sourceName Variable i=0 SourceFluence = NActivity(sourceName, mmonth, mday, myear) D_CC = 50 D_SS = D_CC + convAndCorr[1] FFDE = SourceFluence*convAndCorr[0]/(D_CC)^2 CorrPct = convAndCorr[2]*(D_CC + convAndCorr[1])/100 + convAndCorr[3]*(D_CC/100)^2 +

 $convAndCorr[4]*((D_CC/100)^4) CorrPct += 100*convAndCorr[5]/(4*D_CC^2); // non-point correction added 5/28/02 \\ RealDose = FFDE*(1 + CorrPct/100) TimeUp = 3600*Reading/RealDose$

End

Function PlanCalib()

WAVE SourceFluence = root:InstrCalibAnalysis:SourceFluence

WAVE D_CC = root:InstrCalibAnalysis:D_CC

WAVE CorrPct = root:InstrCalibAnalysis:CorrPct

WAVE D_SS = root:InstrCalibAnalysis:D_SS

WAVE convAndCorr = root:InstrCalibAnalysis:convAndCorr

WAVE RealDose = root:InstrCalibAnalysis:RealDose

WAVE mmonth = root:InstrCalibAnalysis:mmonth

WAVE mday = root:InstrCalibAnalysis:mday

WAVE myear = root:InstrCalibAnalysis:myear

WAVE FFDE = root:InstrCalibAnalysis:FFDE

WAVE/T sourceName = root:InstrCalibAnalysis:sourceName

	Version	Date	Author	Approval	Pages	Filename
	1.10	4/1/2005	AKT		16 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14			
NEUTRON PERSONNEL DOSIMETRY					

Variable i=0
SourceFluence = NActivity(sourceName, mmonth, mday, myear)
D_CC = sqrt(SourceFluence*convAndCorr[0]/RealDose)
for(i= 0; i< 25; i+=1)

 $CorrPct = convAndCorr[2]*(D_CC + convAndCorr[1])/100 + convAndCorr[3]*(D_CC/100)^2 + convAndCorr[4]*((D_CC/100)^4) CorrPct += 100*convAndCorr[5]/(4*D_CC^2);// added - akt 6/8/01 D_CC = sqrt(SourceFluence*convAndCorr[0]*(1 + CorrPct/100)/RealDose) endfor D_SS = D_CC + convAndCorr[1] FFDE = SourceFluence*convAndCorr[0]/(D_CC)^2 CorrPct = convAndCorr[2]*(D_CC + convAndCorr[1])/100 + convAndCorr[3]*(D_CC/100)^2 + convAndCorr[4]*((D_CC/100)^4) CorrPct += 100*convAndCorr[5]/(4*D_CC^2); // non-point correction added 5/29/01 RealDose = FFDE*(1 + CorrPct/100)$

End

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		17 of 28	Procedure14v110

Appendix B: Dosimetry Video Data Acquisition Software

Overview

This is the code used to acquire data from the video frame grabber. It starts the frame grabber software and takes data as specified on the command line. It is maintained on the irdilbert.ncnr.nist.gov CVS server. The code below is from version 1.6 of the code in the CVS repository; validation of subsequent revisions will be noted in CVS comments when they are committed.

The variables \$beforeAfterDiff and \$beforeAfterFrac allow data to be taken at precise intervals, but these depend on the system configuration. Since such precision is only occasionally needed, these are not available as command line options. Validation of these values will be done before any experiment requiring their modification, with the validation procedure and documentation to be entered into the laboratory notebook.

Source Code

```
#!/usr/bin/perl
# Take a bunch of screen grabs and save them in descriptive
file names
use
Getopt::L
onq;
use
File::Pat
h;
my $pause = 10;
my $delay = 60;
our $howLongToSleep
= $delay;
our $howmany = 10;
my $basename =
'100mr';
my $destdir = '.';
my $printhelp = '';
my $printexample =
'';
my $timesArray = '';
our @atTimes;
GetOptions( 'pause:i' =>
     \$pause,
      'delay:i' =>
     \$delay,
      'howmany:i' =>
    \$howmany,
```

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		18 of 28	Procedure14v110

NEUTRON PERSONNEL DOSIMETRY

```
'basename:s' =>
    \$basename,
     'destdir:s' =>
    \$destdir,
     'help|usage' =>
    \$printhelp,
      'example' =>
    \$printexample,
     'timesarray:s' =>
    \$timesArray
     ) or die("unknown
    option");;
if( $printhelp )
   print "DosimDAQ [--pause seconds] [--delay seconds] [--howmany
   numImages]\n";
   print " [--basename fileBaseName] [--destdir destination_directory] [--
   example]\n";
   exit;
if( $printexample )
   print "~/dosimdaq/DosimDAQ --delay 60 --howmany 12 --basename 100mr --
   destdir ./mod/n;
   exit;
if( $timesArray )
   @atTimes = eval($timesArray);
# exit;
   }
else
   @atTimes = eval "(($delay)x$howmany)";
print join(",",@atTimes)."\n";
#exit;
$delay = $atTimes[0];
$howmany = scalar(@atTimes)+1;
PowMgmt, "/private/var/db/SystemConfiguration/com.apple.PowerManagement.xml";
while(<PowMgmt>)
   if( m/.key.Display Sleep Timer.\/key./ )
       $nextline = <PowMgmt>;
       nextline = m/>([0-9]+)</;
      unless( $1 == 0 )
          print "\007\007\007";
          print "Display sleep may kill DAQ\n";
       }
   }
```

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		19 of 28	Procedure14v110

NEUTRON PERSONNEL DOSIMETRY

```
system('open /XLR8\ Folder/Interview/InterView\ Capture');
sleep $pause;
#print "(2) $pause, $delay, $howmany, $basename, $destdir\n";
#$howmany--;
mkpath($destdir, 1, 0755);
our $beforeAfterDiff = 5;
our $beforeAfterFrac = -0.48;
if(0)
   my $howManyFoo = 10;
   $before = time();
   #print "$before\n";
   foreach (1..$howManyFoo)
      my $curTime = time();
      system("screencapture $destdir/$basename".$_."foo.pdf");
print "$basename".$_."foo.pdf $curTime\n";
      sleep 5;
   $after = time();
   $beforeAfterDiff = ($after - $before)/$howManyFoo;
   $beforeAfterDiff -= 5;
   print "beforAfterDiff $beforeAfterDiff\n";
   $beforeAfterFrac = $beforeAfterDiff - int $beforeAfterDiff;
   $beforeAfterDiff = int( $beforeAfterDiff);
   print "beforeAfterFrac $beforeAfterFrac\n";
   $howLongToSleep = $delay - $beforeAfterDiff;
   if (\$beforeAfterFrac > \overline{0.5})
       $beforeAfterDiff += 1;
       $beforeAfterFrac = $beforeAfterFrac-1;
   print "beforAfterDiff final $beforeAfterDiff\n";
   print "beforeAfterFrac final $beforeAfterFrac\n";
our $whichone; $whichone = 1;
my $fracErr = 0;
my $fracFudge = 0;
snapshot();
foreach $delay (@atTimes)
   $fracErr += $beforeAfterFrac;
   if (abs($fracErr) > 1)
       $fracFudge = (($fracErr > 0) ? 1 : -1);
       $fracErr -= $fracFudge;
   else
       $fracFudge = 0;
   $howLongToSleep = $delay - $beforeAfterDiff - $fracFudge;
   sleep $howLongToSleep;
   $whichone++;
```

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		20 of 28	Procedure14v110

```
snapshot();
}
#foreach $whichone (1..$howmany)
#{
# snapshot();
# sleep $howLongToSleep unless ($whichone==$howmany)
#}

sub snapshot()
{
    $curTime = time();

    system("screencapture $destdir/$basename"."$curTime.pdf");
    print "$basename"."$curTime.pdf ($whichone of $howmany)\n";
}
```

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		21 of 28	Procedure14v110

Appendix C: Video Analysis Software

Overview

This is the code used for initial analysis of raw data.

To start, the number of files is entered into the Macro EnterNumFiles. File names (with encoded date and time of acquisition) are entered into the experiment, and converted into date, time, and nominal dose rate by ProcessFileNames. The number of dose rates measured is entered into PrepareToCrunch, which makes a valiant effort to find the starting and stopping values of different dose rates from the nominal dose rates. After confirmation that the starts and stops are correct, the data is analyzed using Crunch or LinAnalyzeAll, depending on whether the data is ratemeter or integration mode. This produces averages, standard deviations, number of points, *etc*.

Minor changes are sometimes made to the code (e.g. the "3000" in the call to CarefulUncertNonCounts in LinAnalyzeAll might be changed if a meter with significantly different sensitivity were used).

This software is also under CVS control on dilbert.nist.gov.

Source Code

Selections from the source code are presented below for information.

```
Macro LinAnalyzeAll()
   duplicate/o measDoses uncertDoses, digits
   digits = 3+((measDoses/(10^floor(log(measDoses))))<2)</pre>
   uncertDoses = CarefulUncertNonCounts( measDoses, digits )
   // "3000" on next line comes from cts/mrem for a typical meter
   // 50 cpm/(mrem/hr) is 3000 cts/mrem
   uncertDoses = max(uncertDoses, measDoses / sqrt(measDoses*3000) )
// uncertDoses = sqrt(measDoses);
// tempcomplex = ()
   avgnomdoses = average(nomdoses,starts,stops);
   averages = real(LinAnalyzeOne(measDoses,tTimes,uncertDoses,starts,stops,0))
   sdevs = imaq(LinAnalyzeOne(measDoses,tTimes,uncertDoses,starts,stops,1))
   chisqs = real(LinAnalyzeOne(measDoses,tTimes,uncertDoses,starts,stops,2))
   //print "scaling standard deviations by sqrt(chisq/dof)";
   //sdevs *= sqrt(chisqs/(stops-starts+1-2))
// calFacs = AvgNomDoses/averages
Function/C LinAnalyzeOne(doseWave, timeWave, uncertWave, startPt,stopPt,whuh)
   wave doseWave, timeWave, uncertWave;
   variable startPt, stopPt, whuh;
   WAVE/D W_coef
   WAVE/D W_sigma
   WAVE/D W_ParamConfidenceInterval
// CurveFit/Q line measDoses[startPt,stopPt] /X=timeWave /W=uncertWave /I=1
/M = dosemask / F = \{0.95, 4\}
   CurveFit/Q line measDoses[startPt,stopPt] /X=timeWave /W=uncertWave /I=1
/F = \{0.95, 4\}
//CurveFit line measDoses[0,38] /X=tTimes /M=dosemask /D /R /F={0.950000, 4}
// print "W_ParamConfidenceInterval[1] = ",W_ParamConfidenceInterval[1];
   if(whuh==2)
```

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		22 of 28	Procedure14v110

NEUTRON PERSONNEL DOSIMETRY

```
return (cmplx(V_chisq,W_sigma[1]));
   else
      return( cmplx(W_coef[1],W_ParamConfidenceInterval[1]) );
   endif
End
// from "Video Analysis" macro file -- AKT 3/3/99 13:54
Function Average(awave, startR, stopR)
wave awave; variable startR, stopR;
wavestats/q/r=[startR, stopR] awave
return( V_avg )
end
Function Sdev(awave, startR, stopR)
wave awave; variable startR, stopR;
wavestats/q/r=[startR, stopR] awave
return( V_sdev )
end
Macro EnterNumFiles(numFiles)
   variable numFiles;
   make/o/t/n=(numFiles) fileList;
   make/o/n=(numpnts(fileList))/d tTimes,nomDoses,measDoses,chisqs
   Edit fileList, tTimes, nomdoses, measDoses;
End
Macro ProcessFileNames()
// use ls *.pict | pbcopy under OS X -- akt 20020819 1535
// variable numFiles = LoadFileNames();
// fileList = IndexedFile(mod, p, "????")
   tTimes = name2timeperl(fileList)
   nomDoses = name2nomDose(fileList)
   ModifyTable width(fileList)=160
   SetScale d 0,0,"dat", tTimes
   ModifyTable format(tTimes)=8,width(tTimes)=126
End
// apparently broken under OSX -- akt 20020819 1534
Function LoadFileNames()
   NewPath /o/m="Select directory of video images" mod
   string fubar;
   fubar = IndexedFile( mod, -1, "????")
   if( strlen(fubar)==0 )
      abort
   endif
   variable numFiles = NumInList( fubar, ";");
   make/o/n=(numFiles)/t fileList
   return numFiles;
End
Function/D name2timeperl(aString)
   string aString;
str2num(aString[strsearch(aString, "mr", 0)+2, strlen(aString)])+date2secs(1970, 1, 1
) - 4*3600
End
Function/D name2time(aString)
   string aString;
   return str2num(aString[strsearch(aString, "mr", 0)+2, strlen(aString)])+2^31
Function name2nomDose(aString)
string aString
return str2num(aString[0,strsearch(aString,"m",0)])
```

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		23 of 28	Procedure14v110

NEUTRON PERSONNEL DOSIMETRY

```
Macro PrepareToCrunch(numberDoseRates)
   variable numberDoseRates;
   // added "numMeas" -- akt 20021001 1155
   make/o/n=(numberDoseRates)/d averages, sdevs, AvgNomDoses, starts, stops,
calFacs, numMeas //,tempcomplex
// redimension/c tempcomplex
   edit starts, stops, AvgNomDoses, averages, sdevs, calFacs
   FindStartsStops( nomDoses, starts, stops );
   numMeas = stops-starts+1
   AvqNomDoses = NaN;
   averages = NaN;
   sdevs = NaN;
   calFacs = NaN;
Function FindStartsStops(nomDoses, starts, stops )
   wave nomDoses, starts, stops;
   variable i,j;
   starts[0] = 0;stops[numpnts(stops)-1]=numpnts(nomDoses)-1;
   for( i=0, j=0; i<numpnts(nomDoses); i+=1)</pre>
      if( nomDoses[i+1] != nomDoses[i] )
          starts[j+1] = i+1;
          stops[j] = i;
          j+=1;
      endif
   endfor
End
Macro Crunch()
   averages = average( measDoses, starts, stops )
   sdevs = sdev( measDoses, starts, stops)
   AvgNomDoses = average( nomDoses, starts, stops )
   calFacs = AvgNomDoses/averages
Macro dCrunch()
   averages = average( dmeasDoses, starts, stops )
   sdevs = sdev( dmeasDoses, starts, stops)
   AvqNomDoses = average( nomDoses, starts, stops )
   calFacs = AvgNomDoses/averages
Function/d CarefulUncert(counts,digits)
// given a wave of counts and a number of digits the meter reads, return the
real uncertainty in number of counts
// -- akt 2001-11-14 1203
variable counts; variable digits;
return( max(10^(floor(log(counts))-digits+1),sqrt(counts)) );
Function/d CarefulUncertNonCounts(reading,digits)
// given a wave of readings and a number of digits the meter reads, return the
(minimum) uncertainty in reading
// -- akt 2001-11-14 1203
variable reading; variable digits;
return( 10^(floor(log(reading))-digits+1) );
End
Function/D fit4drift(coeffs, x) : FitFunc
   wave coeffs; variable x;
   variable result;
   // coeffs = {t0, y0, R, f, tau}
   x -= coeffs[0];
   result = coeffs[1] + coeffs[2]*x + coeffs[2]*coeffs[3]*coeffs[4]*exp(-
x/coeffs[4]);
   return result;
End
```

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		24 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14
NEUTR	ON PERSONNEL DOSIMET	ΓRY

Appendix D: Uncertainty Analysis

Single Calibration Factor

For a single calibration factor, example uncertainties are shown below in Table 1.

Table 1: Example Uncertainties

Description	Type A (%, k=1)	Type B (%, k=2)	How Determined
Instrument Reading	0.2		Std. Dev. of readings
Source Strength		2.6	2.6 bare, 2.4 mod.
Room Return & Air Scatter correction		1.8	0.4 * Total Correction
Fluence / Dose Equivalent Conversion		2	2% bare, 8% mod.
Effective Source-Detector Distance		5.1	0.5 cm*2/ source-detector distance
Quadratic Summation (k=2)	0.4	6.3	

The relative combined expanded standard uncertainty is also 6.3%, as the type B uncertainties dominate the combined uncertainty.

Weighted Overall Uncertainty

Individual calibration factors at a given dose equivalent rate are combined into a weighted calibration factor. To do this, a weighted average of the uncertainties that are uniform across all measurements (Source Strength, Conversion, and Correction) is added in quadrature with a weighted average of the uncertainties that vary with each measurement (Distance, Instrument Reading). The uniform uncertainties are weighted by the varying uncertainties for that weighted average.

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		25 of 28	Procedure14v110

Appendix E: Sample Calibration Report

U. S. DEPARTMENT OF COMMERCE National Institute of Standards and Technology Gaithersburg, MD 20899

Report of Test

Instrument Submitted by: Zaphod Beeblebrox

Ronald Reagan Center for High Energy Physics

Ref PO # 17025838588 Receiving - Bldg 100 Waxahachie, TX 75168

Dates of Irradiation: August 7, 2003

Report Date: October 15, 2003

Instrument Calibrated

Type of instrument: PKMA Model KM-3

Quantity:

Serial Number: 3735928559

Neutron Sources

Californium-252 spontaneous fission sources with the following emission rates were used in this calibration:

Source Emission Rates

Source	Emission rate	Uncertainty
NS-130	1.35×10 ⁸ n/s	1.2 %
NS-108	$1.60 \times 10^7 \text{ n/s}$	1.2 %

Sources NS-130 and NS-108 were moderated in the NIST 30 cm diameter heavy water sphere.

Methods & Results

The instrument was mounted on a stand and measurements were made at various distances from one or another of the sources to obtain different dose equivalent rates. The meter was put into "integrate mode" and the integrated measured dose was read out approximately once per minute. The first two columns in the table list the source and distance combinations used.

The third column in the table below lists the "Free Field Dose Equivalent" (FFDE) Rates corresponding to the source-distance combinations used. The FFDE rate is the dose equivalent rate due to neutrons from the source alone, in the absence of background caused by neutrons scattered into the instrument from the walls, the air in the room, and the source support. The FFDE rate, in mrem/hr, are calculated from the formula:

FFDE Rate = $2.30 \times 10^{-3} \text{ O/r}^2$

where Q is the source emission rate (n/s) and r (cm) is the distance listed in the table. The FFDE rate in μ Sv/h is just ten times the FFDE rate in mrem/hr.

NIST Test No. xxxxxx-03 No. 44060C Page 1 of 3 October 15, 2003

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		26 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14		
NEUTRON PERSONNEL DOSIMETRY				

The next column in the table gives the actual dose equivalent rate received by the instrument. This is the FFDE corrected for the backgrounds mentioned above. The corrections range from 4.2% to 7.8% depending upon the distance.

The actual dose, divided by the instrument reading, gives the calibration factor listed in the last column of the table. The calibration factor is thus the factor by which the instrument reading should be multiplied to get the true dose equivalent rate, in mrem/hr. These calibration factors should be multiplied by a factor of ten to get the dose equivalent rate in $\mu Sv/h$.

The last column also gives the combined standard expanded uncertainties (k=2) in the calibration factors. These uncertainties defines an interval around the quoted calibration factors within which the unknown value of the calibration factors is believed to lie with a level of confidence of approximately 95 percent. These uncertainties include both Type A uncertainties and Type B uncertainties (i.e. uncertainties determined by other than strictly statistical means). The Type A uncertainties, for these data, are all less than 1% and are the uncertainty in the fit value for the slope of dose versus time. The Type B uncertainties include: the uncertainty in the source strength (2.4%), uncertainty on the neutron scatter correction (1.7% to 3.1%, depending on the distance from the source), and the uncertainty in the location of the effective center of the instrument (2.2% to 7.0% depending on the distance from the source), and the uncertainty in the conversion from neutron fluence rate to dose equivalent (8%); these conversion factors are the dominant uncertainty for all dose equivalent rates. The main Type B uncertainties are in the source calibration, neutron scatter correction, and in the distance from the source to the instrument for the highest dose equivalent rates. The value listed for the mean is the weighted mean of the listed calibration factors.

To test the stability of the instrument, the measurement at 100 mrem/hr was repeated after all other measurements were complete. The instrument reading (111 mrem/hr) had increased by approximately 7%; this is not unusual for meters of this type.

Measurements associated with this calibration were performed by:

	For the Director, National Institute of Standards and Technology
Alan K. Thompson, Physicist	Lisa Karam, Acting Chief Ionizing Radiation Division Physics Laboratory
David M. Gilliam, Leader Neutron Interactions & Dosimetry Group	

NIST Test No. xxxxxx-03 No. 44060C Page 2 of 3 October 15, 2003

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		27 of 28	Procedure14v110

Ionizing Radiation Division	44060C	IRD-P-14					
NEUTRON PERSONNEL DOSIMETRY							

Dates of Irradiation: August 7, 2003

Type of instrument: PKMA Model KM-3

Quantity: 1

Serial Number: 3735928559

Moderated Californium

	Distance (D)	Free-Field	Actual	Instrument		
Source	(center-to-	Dose equiv.	Dose equiv.	Readings,	Calibration	
	center), cm	Rate, mrem/hr Rate, mrem/hr		mrem/hr	Factor	
NS-108	89.0	4.6	5.0	5.2	0.97 ± 9 %	
NS-108	62.1	9.5	10.0	10.4	0.96 ± 9 %	
NS-108	43.8	19.2	20	20	0.99 ± 9 %	
NS-130	81.6	47	50	52	0.95 ± 9 %	
NS-130	57.1	96	100	104	0.96 ± 9 %	
NS-130	40.3	192	200	213	0.94 ± 9 %	
NS-130	28.7	377	400	440	0.91 ± 9 %	
				Average	0.96 ± 8.7%	

NIST Test No. xxxxxx-03 No. 44060C Page 3 of 3 October 15, 2003

Version	Date	Author	Approval	Pages	Filename
1.10	4/1/2005	AKT		28 of 28	Procedure14v110